

Beede Electrical Instrument Company, Inc. 88 Village Street, Penacook, NH 03303-8910 Phone: (603) 753-6362 FAX: (603) 753-6201

Since 1917 Visit our WEB site http://www.beede.com ISO 9001 CERTIFIED

AGRICULTURAL •

- AUTOMOTIVE •
- INDUSTRIAL .
- - MARINF TRUCK •
 - BUS .

workmanship and materials on gauges that are less than three (3) years old or have been in service fewer than two (2) years and, at no charge, will replace or repair at Beede's option all instruments that fail. Contact Beede for complete details.

Beede Electrical Instrument Co., Inc. warrants all

instruments and accessories free from all defects in

WARRANTY

2" Air-Core Gauge W/Connector Installation Instructions

WARNING

Improper installation may damage the instrument and/or cause injury to the installer. If you have installation questions, please contact the factory.

Disconnect battery cables before installing the instrument.

Check for obstructions behind dash panel such as wires and hoses before cutting the mounting hole for the instrument.

MOUNTING

Recommended dash hole size: 2.125±.015 in (53.98±0.38 mm) DIA. Secure the instrument into dashboard with mounting "J" clamps and Kep nuts. If dashboard thickness exceeds clamp grip range, clamp legs may be shortened.


Caution, over tightening mounting hardware may damage the instrument.


Position instrument in dash board prior to tightening clamp nuts to recommended torque. Maximum recommended tightening torque for all hardware: 6 lb-in (0.68 N-m). MAINTENANCE Periodically check and torque all hardware per mounting specifications. Clean glass with a soft, damp, clean cloth. THANK YOU! Thank you for purchasing a Beede instrument.


Our instruments are made for you in the U.S.A. Visit our WEB site at www.beede.com or contact customer service for information on this or other Beede instruments.

KEP NUT —		/		1
				Integral 6 mates with DT Series
6	A CAR	100	MOUNT	ING "J" CLAMP

Gauge Wiring Table				
Gauge Pin	Connection Name			
Number	Standard Gauge	Voltmeter		
1	Battery +	Battery +		
2	Ground	Ground		
3	Sender Signal	No Connection		
4	Lamp (+12V)	Lamp (+12V)		
5	No Connection	No Connection		
6	No Connection	No Connection		

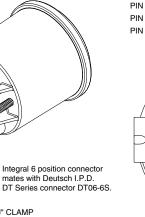

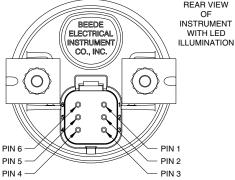

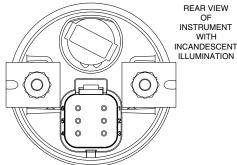

547479 REV A 05/05/04